## **TECHNICAL & SAFETY COMMITTEE**



## INTERNATIONAL PARACHUTING COMMISSION (FAI)

Technical & Safety Information Notice No.	01/2011 Container - ICON W.N. 36
Date of Issue	19 January 2011
Subject Matter and Applicability	Aerodyne Mandatory Service Bulletin SB140111 ICON SKYHOOK RISER TUCK TAB MODIFICATION Issue Date: 14 January 2011
	<b>Identification:</b> Icon Containers with Skyhook Option manufactured prior to January 14, 2011.
	For full details go to: http://www.flyaerodyne.com/download/SB140111.pdf
Compliance	Mandatory, before next jump.
Concerned Publication	Aerodyne Research LLC Mandatory Service Bulletin SB140111
Authority	William D. Legard, President Aerodyne Research LLC.
Notice	<b>Background:</b> We have become aware of recent instances in which a Skyhook Icon was incorrectly packed with the main risers misrouted under the reserve tab causing a riser cover to not release the main riser when the main was deployed. This led us to investigate to update the design to reduce the probability of the main or the reserve risers not being extracted fully upon deployment in the case of incorrect placement of the main risers.
	During these tests we also found that some combinations of Skyhook Icon components (rig size, reserve size, riser size, packing configuration) could potentially result in an incomplete riser deployment when deploying the reserve during a total malfunction. In a total malfunction, the main risers do not clear the riser covers, and in some combinations, the reserve riser covers could potentially lock in place during the reserve canopy deployment. The reserve canopy would deploy and inflate correctly, but the unreleased risers would cause the jumper to be suspended from the back of the shoulder rather than from the front of the shoulder as designed.
	Aerodyne has modified and tested an updated riser tuck tab design to prevent these occurrences and has as a general update and safety measure decided to implement this design in all Icons equipped with a Skyhook. Aerodyne also reminds that the packing configuration of the main risers being placed above the bottom flap is still important to follow also after this modification.

	Action Required: Please contact Aerodyne to arrange for your Icon to be returned and for the updated tuck tabs to be fitted. Once contacted, Aerodyne will coordinate shipping and the installation of the updated tabs, all at no cost to the rig owner. Aerodyne Research, LLC 1405 Flightline Blvd Unit 20 Deland, FL 32724 813-891-6300
Acknowledgement	<ul> <li>Thanks to Ms Kim Hardwick, Technical Officer, Australian Parachute Federation, for bring this Aerodyne Research LLC Service Bulletin to our notice.</li> <li><i>Liam McNulty</i></li> <li>IPC Technical &amp; Safety Committee 19 January 2011.</li> </ul>

Technical and Safety Information Notices issued by the Technical & Safety Committee of the International Parachuting Commission (FAI) are issued as information and help to parachuting nations and their affiliated members. The Information Notices are of an objective informative nature and there is no direct or implied criticism of any manufacturer or product intended. The Information Notices do not claim to be complete.

The Information Notices may result from:-

- 1 An incident or experience in the field being reported.
- 2 A directive or notice issued by an aviation or government authority concerning parachuting operations or parachuting equipment.
- 3 The issue of a notice by a manufacturer or by a National Parachuting Organisation. In the case of equipment being the subject of the bulletin the reader is advised to check with the manufacturer regarding the current status or position of that equipment.

Technical & Safety Committee of IPC, IPC and FAI accept no liability for the use or misuse of any information contained in this Information Notice. The reader assumes all liability.

The Technical & Safety Committee, International Parachuting Commission, can be contacted on e-mail - <u>Imcnulty@skydiveireland.ie</u>

Liam McNulty, Technical & Safety Committee, International Parachuting Commission. 19 January 2011