
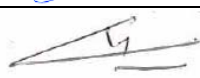


AERAZUR 2 rue Maurice Mallet 92130 Issy les Moulineaux Tél. 33 1 41 23 23 23 Fax 33 1 46 48 83 41	<h2>Service Bulletin</h2> <p>Title : Improvement of the Harness/container Titre: amélioration des sacs/harnais biplaces</p>	BS-25-63-34 Date: 31/07/2007 Page 1/8
--	--	---

Block 1	<u>Technical Background</u>	
a)	Applicability	: <u>Dual harness/containers</u> : 740-1 (ATOM TANDEM) and MMS 740-2 manufactured before 2002 as presented in page 2.
b)	Reason	: Packing procedure not correctly applied and improvement of the center flap design.
c)	Description	: During a tandem jump a main canopy line has been caught under the center flap in the configuration: <ul style="list-style-type: none"> ➤ Improperly packing process: The elastic band was not inserted through the lateral grommets of the POD. In this configuration, at the extraction of the POD out of the container, some lines can be extracted from the elastic band and fly close to the center flap. ➤ The drogue was released during the rotation of the jumpers. Background demonstrates that this configuration can appear again, the improvement of the center flap will reduce the risk of blocking.
d)	Compliance	: The reminder of the packing procedure has to be applied immediately. As a precaution, the improvement of the center flap must be done at the next periodic inspection/packing of the reserve according to the technical manual or the local regulation.
e)	Approval	: The technical content of this service bulletin has been approved by Aerazur according to Part 21 - §21A.211.
f)	Labour	: Senior or master rigger or equivalent according to the local regulation.
g)	Weight and balance	: Non applicable
h)	Reference document	: Non applicable
i)	Publication concerned	: User Manual (ATOM TANDEM 740-1) Ed 2 July 95 (PN : P9009112500) User Manual (ATOM TANDEM 740-2) Ed 04.1 December 99 (PN : P9009112400)
j)	Interchangeability	: Non applicable

Block 2	<u>Information about equipment</u>	
a)	Material	: Non applicable
b)	Supplier	: AERAZUR / Parachutes de France, 2 rue Maurice Mallet, 92130 Issy les Moulineaux, France Web site : www.parachutes-de-France.com E-mail : infopdf@zodiac.com Tel : +33 (0)1 41 23 23 23, Fax : +33 (0)1 46 48 83 41

Block 3	<u>Accomplishment instructions:</u>	
According to instruction and drawing described on the following pages.		

Block 4	Diffusion	Block 5	Quality Department Approval	
DGAC – GSAC – FFP ARZ – Dealers – Users		Date	Name	Visa
		31/07/2007	B. DELAHOICHE	
		31/07/2007	P. CHAVANON	

Service Bulletin

Title : Improvement of the Harness/container
Titre: amélioration des sacs/harnais biplaces

Identification of the containers

This Service Bulletin concerns these two designs:

First generation



Second generation



This design is not concerned by this Service Bulletin :




Please consider the orientation of the inner flap between the second and the last generation



Service Bulletin


Title : Improvement of the Harness/container
Titre: amélioration des sacs/harnais biplaces

Improvement:

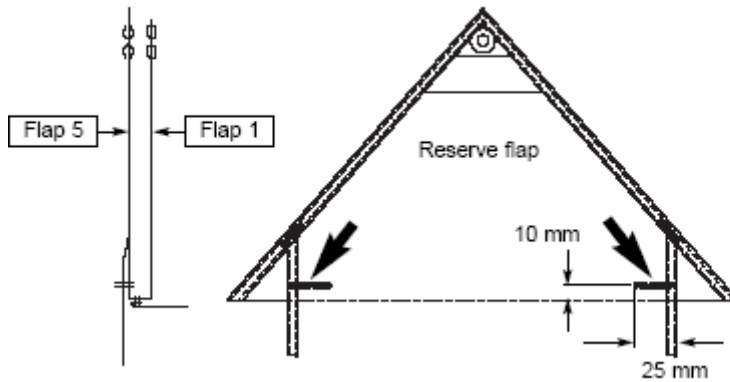

Make a stitching as like drawing upper.

Sewing machine: Bartack 42 pts / One needle / ZIG ZAG 3 points.
Thread: Polyamide 30/3 or size "E" nylon thread

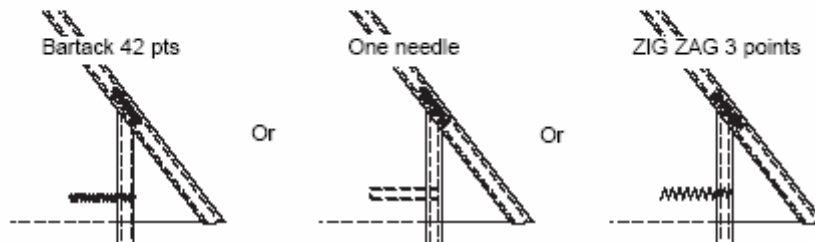

Inside the reserve container



Outside the container



Inside the first generation main container (stitching hidden)

Service Bulletin

Title : Improvement of the Harness/container
Titre: amélioration des sacs/harnais biplaces

Reminder of the packing procedure:



The elastic band has to go through the lateral grommets of the POD