

Equipments affected :

FLEXPACK Harness-container (P/N 8002012200).
FLEXPACK Harness-container (P/N 80020130 or 8002013000)

Observations :

Disconnection between the metallic housing of the activating cable and its fixing collar (on pin side) as a result of the loosening of the collar screws.

Relevant information concerning the inspection of the Harness-Container :

The inspection of the metallic housing of the activating cable during maintenance operations must include the inspection of the housing fixation by the container fixing collar.

The fixing collar must be tightly screwed on so that the metallic housing may not move (Picture 1).

In case the metallic housing moves :

- Remove the nuts (NYLSTOP inox nut - 3mm in diameter)
- replace them by new ones
- Screw them on tightly but not too much.



Picture 1