



22 Bosci Rd, Ingleburn NSW 2565 Australia (P:O Box 969) Ph: + 61 2 98295355 Fax: +61 2 98291300

## SERVICE BULLETIN No PA SB9302

## Issued 18 August 1993

## SUBJECT: S18 INSPECTION FOR SECURITY OF THE STIFFENER PLATE

**STATUS:** ADVISORY


**IDENTIFICATION:** Part No. S018-SOS-( ), all serial numbers Part No. S018-TAS-( ), all serial numbers

**BACKGROUND:** PA has received advice from the field that the mesh material which retains the reserve top metal stiffener in the reserve container had broken away and could affect the reserve deployment.

## MANUFACTURER ADVISORY:

Prior to the next use, and thereafter at each scheduled reserve inspection, the security of the top flap stiffener plate shall be checked. If damage is evident the parachute shall be withdrawn from service until a satisfactory repair has been accomplished.

**AUTHORITY:** Managing Director Underline Designs Pty Ltd trading as Parachutes Australia Stiffener Plate

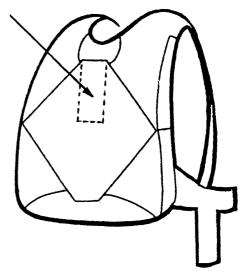

COMPLIANCE DATE: 18 August, 1993.

**DISTRIBUTION:** Scribers to APF Service Bulletin service.