



RIGGING ADVISORY CIRCULAR

Issue Date: 01 November 1985

RAC No. 407 Rev. A

SUBJECT MIRAGE CONTAINER MODIFICATION

STATUS Advisory

IDENTIFICATION Mirage Container System built by Sky Supplies, built before April 1, 1983.

MANUFACTURER Sky supplies has made a minor change to the design of an internal
ADVISORY flap of its Mirage Reserve Container.


Mirages built before April 1, 1983 should be modified to the new configuration. The work may be done by an FAA Master Rigger (APF Rigger) or Sky Supplies.

The change involves shortening the kicker flap as shown in the sketch below.

A rig sent in to Sky Supplies will be repaired at no charge.

PROCEDURE Measure down 7 inches from the tip of the inner #1 kicker flap. Use a heavy pair of shears to remove the bottom of the flap (including the bottom grommet).

Sear the edge of the fabric with a hot knife and bind the exposed edge with $\frac{3}{4}$ " type 3 nylon tape (MIL-T-5 038), matching the existing construction method.

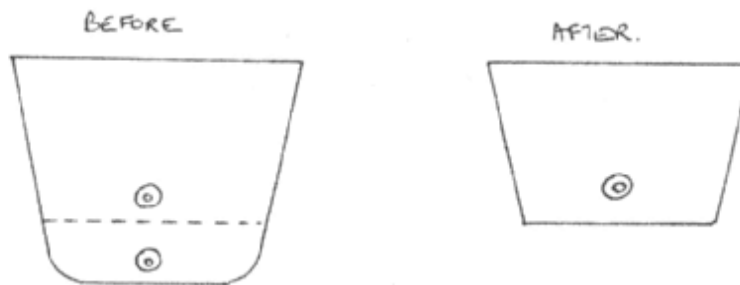

EFFECTIVE DATE April 1, 1983

AUTHORITY Sky Supplies, the manufacturer through the PEIA Newsletter

DISTRIBUTION All APF Packers and Riggers